


Customer: LSX Date: 01/14/2021 Phone: 979.209.0325

| Injector Cleaning Service Data Sheet | | | | | | | | |
|--------------------------------------|--------|--------|--------|--------|--------|--------|--------|--------|
| Injector # | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 |
| Resistance in Ohm | 7.1 | 7.1 | 7.2 | 7.2 | 7.1 | 7.1 | 7.1 | 7.2 |
| Leak Test | Pass | Fail | Pass | Pass | Pass | Pass | Pass | Pass |
| Pass/Fail | Pass |
| Spray Pattern | Good | Poor | Good | Good | Good | Good | Good | Good |
| Good/Fair/Poor | Good |
| Static Flow Before | 2100 | 1980 | 2160 | 2040 | 1920 | 1860 | 2160 | 2040 |
| Static Flow After | 2200 | 2250 | 2220 | 2230 | 2200 | 2220 | 2250 | 2200 |
| Flow In LB/HR | 209.52 | 214.29 | 211.43 | 212.38 | 209.52 | 211.43 | 214.29 | 209.52 |
| % Change Per/Injector | 4.76% | 13.64% | 2.78% | 9.31% | 14.58% | 19.35% | 4.17% | 7.84% |
| | | | | | | | | |
| Test Pressure (PSI) | 43.5 | | Before | | After | | | |

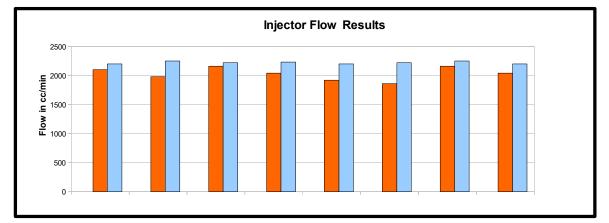

Comments

#2 injector was leaking and did not have good spray pattern when arrived

| Parts Replaced | | | | | | | |
|---------------------|-----|------------------------|-----|--|--|--|--|
| Part | Qty | Part | Qty | | | | |
| Filter Baskets | 0 | Bottom Seals / O-Rings | 8 | | | | |
| Pintle Caps | 0 | Cushions | 0 | | | | |
| Top Seals / O-Rings | 8 | Spacer | 0 | | | | |

LSX Power Tuning 205 Wildflower Rd Brenham TX 77833 Call us at: 979.209.0325 Email us at: info@lsxpowertuning.com